



KARNATAKA STATE FIRE AND EMERGENCY SERVICES DEPARTMENT

**Office of the District Fire Officer,
Banaswadi Fire Station, Banaswadi Main Road,
Kalyan Nagar Post, Bengaluru-560 043.
Ph. No. 080-22971540 / 22971611.**



No. 17/SCHOOL/CC/DFO/BWFS/2026.

Date: 08-07-2026

'ANNEXURE - B'

Group- B Educational Building.

To,

**The Chief Educational Officer,
M/s. Sree Vidyanikethana School,
(School U-DISE No. 29200310164)
No.18, 1st Cross, Sree Venkatagiriappa Layout,
R.R. Temple Road, Varanasi,
Bengaluru-560 036.**

Sub: Issue of '**Fire Safety Compliance Report**' with respect to fire prevention, fire fighting and evacuation measures maintained at '**M/s. Sree Vidyanikethana School**', No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036.

Ref: 1. FSR report No.17/SCHOOL/FSR/DFO/BWFS/2026, Dated: 07-07-2026.
2. Your request letter, Dated: 07-07-2026.
3. Fire Station Officer, Banaswadi Fire Station, Inspection Report
No.18/SCHOOL/CC/FSO/BWFS/2026, Dated: 08-07-2026.

With reference to subject above cited, 'fire safety recommendation' was issued wide reference (1) to the premises of **M/s. Sree Vidyanikethana School**, Comprising of Ground & 03 upper floors had height 13.07 mtrs. Situated at No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036 with a condition to fulfill the recommendations and compliance the same within 03 months.

With reference cited (2) above, the management of **M/s. Sree Vidyanikethana School** had requested for the fire safety compliance report from our department. In this regard the building was inspected by the Fire Station Officer, Banaswadi Fire Station on



8/7/26

08-07-2026 & submitted the inspected report cited in reference (3) above & recommended to issue of fire safety compliance report.

Under the above circumstances the Karnataka State Fire & Emergency Services Department is issue the **Fire Safety Compliance Report** to '**M/s. Sree Vidyanikethana School**', Comprising of Ground & 03 upper floors had height 13.07 mtrs. Situated at No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036. Subject to proper maintenance of fire fighting systems in good working conditions and to impart training for at-least 40% of staff/ employees should be trained in basic fire fighting at R.A. Mundkur Fire & Emergency Services Academy, Bannerghatta Road, Bengaluru at an earliest.

This fire safety compliance report is issued from the fire prevention and fire fighting point of view the Karnataka State Fire & Emergency Services Department is not responsible for the ownership of the land, its location and other disputes, which may arise in due course.

"In case the fire prevention and fire fighting measures installed in the building as per the recommendation of the department are not maintained in good working condition, if the evacuation measures are not properly followed and if any additional construction work is taken up in the building/premises, this fire safety compliance report deemed to be cancelled and necessary legal action will be initiated against the developer / management / tenant and also separate NOC has to be obtained from the department for the storage of Chemicals, Solvents, Petroleum products (Diesel/Petrol), LPG, etc in the premises/ building."

"This Fire Safety Compliance Report is issued for the period of only One Year from the date of issue and it is renewable without fail".

Yours faithfully,


8/7/2026
District Fire Officer
Karnataka State Fire and Emergency Services
Banasawadi Fire Station
Banasawadi, Bengaluru - 560043.

Copy to: Fire Station Officer, Banaswadi Fire Station.





KARNATAKA STATE FIRE AND EMERGENCY SERVICES DEPARTMENT

Office of the District Fire Officer,
Banasawadi Fire Station, Banasawadi Main Road,
Kalyan Nagar Post, Bengaluru-560 043.
Ph. No. 080-22971540/22971611.



No. 17/SCHOOL/FSR/DFO/BWFS/2026

Date: 07-07-2026

To,

**The Chief Educational Officer,
M/s. Sree Vidyanikethana School,
(School U-DISE No. 29200310164)
No.18, 1st Cross, Sree Venkatagiriappa Layout,
R.R. Temple Road, Varanasi,
Bengaluru-560 036.**

Sub : Issue of **Fire Safety Recommendation** to '**M/s. Sree Vidyanikethana School**, Situated at No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036.

Ref : 1) Your request letter, Dated: 29-06-2026.
2) Fire Station Officer, Banaswadi Fire Station, Inspection Report No. 20/SCHOOL/FSR/FSO/BWFS/2026, Dated: 07-07-2026.

With reference to the subject above cited, I wish to state that the educational building of **M/s. Sree Vidyanikethana School** Situated at No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036 was inspected by the Fire Station Officer, Banaswadi Fire Station on 01-07-2026 & submitted the inspected report cited in reference (2) above & recommended to issue of fire safety recommendation with respect to fire prevention, fire fighting and evacuation measures to be complied in the above premises. The details are as under:-

ANNEXURE-B

"B1 & B2- Schools upto senior secondary level and other institutions"
NBC-2016, Part-4, Table 7(11) 3.1.3 Group 'B' Educational Buildings
(These condition are indicative and not exclusive all relevant provisions related to fire and life safety of NBC 2016 & Government order No. HD/210/SFB/2025, Bengaluru, Dated: 12/01/2026 are mandatory)



7/7/26

A. Details of the building / Premises :-

1.	Name and address of the applicant.	:	The Chief Educational Officer, M/s. Sree Vidyanikethana School, No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036.
2.	Name and address of the premises.	:	M/s. Sree Vidyanikethana School, (School U-DISE No. 29200310164) No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036.
3.	Name and address of the building owner.	:	The Managing Trustee, M/s. Sree Venkatagiri Charitable Trust, No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036.
4.	Number of building.	:	One building
5.	Number of floors.	:	Ground & 03 upper floors.
6.	<u>Floor-wise details of occupancy:-</u>		
	Ground floor	:	04 Class rooms, 01 office room, 01 staff room, 01 computer lab & 01 store room.
	1 st Floor	:	07 Class rooms.
	2 nd Floor	:	06 Class rooms & 01 projector room.
	3 rd Floor	:	02 Class rooms, 01 library, 01 science lab & 01 computer lab.
7.	Height of the building.	:	13.07 Mtrs.
8.	Total site area.	:	4,089.21 Sq. mtrs.
9.	<u>Built-up area of each floor:-</u>		
	Ground floor	:	542.00 Sq. Mtrs.
	1 st Floor	:	542.00 Sq. Mtrs.
	2 nd Floor	:	542.00 Sq. Mtrs.
	3 rd Floor	:	542.00 Sq. Mtrs.
10.	Total built-up area.	:	2168.00 Sq. Mtrs.



11.	Surrounding properties:-		
	East (Front)	:	Residential building.
	West (Rear)	:	06.50 mtrs. wide 2 st Cross road.
	North (Side)	:	06.50 mtrs. wide 1 st Cross road.
	South (Side)	:	Vacant land.
12.	<u>Set-back area available around the building :-</u>		
	East (Front)	:	Min. 12.00 mtrs.
	West (Rear)	:	0.90 Mtr.
	North (Side)	:	0.90 Mtr.
	South (Side)	:	07.20 Mtrs.

B. On inspection of this Educational building premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl.No. (1)	Details (02)	Existing (03)	Recommendations (04)
1.	Accessibility to the premises.	The premises is accessible from 06.50 mtrs. 1 st Cross road located on northern side & the road is hardened to carry the load of 45,000 kgs.	Adequate
2.	No. of entrance.	01 Entry cum exit have been provided.	---
3.	Width of entry / exit.	05.50 mtrs. (Northern side).	---
4.	Diesel generator.	One diesel generator of 15.00 KVA capacity has been provided to supply alternate power to all emergency provisions of the building.	Complied



7/7/26

5.	No. of staircases available.	Nos. of staircases	02 Nos.		Complied.
		Width of staircases	01.50 mtrs.	01.50 mtrs.	
		Width of treads	30 cms.	30 cms.	
		Height of risers	15 cms.	15 cms.	
		Nos. of riser per flight	08 nos.	08 nos.	
		Height of handrails	01.20 mtrs.	01.20 mtrs.	
6.	No. of lifts and capacity.	No. of lifts.	01 No.		
		Capacity of lifts.	04 Persons capacity.		
7.	Fire extinguishers.	25 Nos. of ABC type fire extinguishers each of 06 kgs. capacity, 01 no. of CO2 type fire extinguisher of 4.5 kgs capacity & 01 no. of mechanical foam fire extinguisher of 09 ltrs. capacity have been provided.			Complied.
8.	First aid Hose reel hose.	Provided 01 no. of hose reel hose system at staircase landing area and G.I pipe of min 63 mm size & hose reel hose of min 19 mm size of adequate length to reach farthest point of each floor with shut off branch having nozzle of 5mm size. The hose reel hose is connected at each landing by means of an adapter.			Complied.



21/12/26

9.	RCC / FRP tank over respective tower terrace or Under ground static water storage tank.	Provided 5000 ltrs. capacity of water tank at terrace level exclusively for fire fighting purpose.	Complied.
10.	Pump near RCC / FRP tank over respective tower terrace / Under ground static water storage tank (Fire pump) with minimum pressure of 3.5 kg/cm ² .	The hose reel hose system has been connected to an booster pump capable of delivering 450 litres per minute discharge capacity.	Complied.
11.	Escape routes.	Escape route are marked with luminous paint at each floor directing towards exists and emergency exists.	Marked.
12.	Fire order. (Fire safety plans)	Fire safety indicating the details of action to be taken in case of emergency have been displayed near each staircase landings with the telephone numbers of Banaswadi fire station i.e. 080-22971540, fire control room i.e 101/ 080-22971500/550/600& telephone numbers of nearest ambulance service & police station.	Displayed.
13.	No smoking board.	COTPA Sec-4 direction "NO SMOKING"area-smoking here is an offence, board have been written in English & Kannada both language has been prominently displayed at inside the entry / exit of the each floor.	Displayed.



21/2/26

13.	Nominate one fire nodal officer.	Not nominated.	A fire nodal officer shall be nominated either from teaching or non-teaching staff.
14.	Fire fighting training.	Not imparted.	At least 40% of staff should be trained in basic fire fighting course at our R.A.Mundkur Fire and Emergency Services Academy, Bannerughatta Road, Bangalore-29 at an earliest.
15.	<u>Fire precautionary measures :-</u> A) Explosive and flammable materials should not be stores in the store room, UPS room, Electrical panel area, class rooms, laboratory & electrical sum panel premises. B) Accumulation of combustible waste in and the premises should be avoided. C) The exit ways shall be always kept clear without any obstruction. D) Liquefied petroleum gas should not be stores in the building. E) The doors shall not be kept locked / latched during working hours and shall be free from obstruction. F) During the class hours the class room doors shall not be locked from inside to out side. G) As per Honorable Supreme Court order all teachers and staffs shall be trained to handle safety equipment, initiate emergency evacuation and protect their students in the event of fire and other emergency and the school shall observe the Fire Safety Day on April 14th of every year be conducting Fire Safety drills with co-ordinate Fire Service department.		



7/12/26

Under the above circumstance the Karnataka state Fire & Emergency Services Department is issuing of **Fire Safety Recommendation** to 'M/s. Sree Vidyanikethana School', Comprising of Ground & 03 upper floors had height 13.07 mtrs. Situated at No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036. Subject to condition and compliance of the above recommendations in/column-4 of serial-B within 03 months and compliance to the undersigned.

This 'Fire Safety Recommendation' is issued for a period of only One Year from the date of issue and it is renewable.

Yours faithfully,


District Fire Officer
Karnataka State Fire and Emergency Services
Banasawadi Fire Station
Banasawadi, Bengaluru - 560043.

Copy to: Fire Station Officer, Banaswadi Fire Station.



ಚಲನ್ ಚಾಲ್ತಿ ಅವಧಿ Challan Validity	ಜಿಲ್ಲೆ District	ಇಲಾಖೆ Department	ಡಿಡಿಒ ಕಚೇರಿ DDO Office	
7 Days	BENGALURU URBAN	DEPARTMENT OF KARNATAKA FIRE & EMERGENCY SERVICES	DIVISIONAL FIRE OFFICE, BANGALORE NORTH RANGE, KARNATAKA FIRE AND EMERGENCY SERVICES, BANGALORE	
ವರ್ಗ Category	ದಿನಾಂಕ Date	ಚಲನ್ ಉಲ್ಲೇಖ ಸಂಖ್ಯೆ Challan Reference Number	ಡಿಡಿಒ ಕೋಡ್ DDO Code	
Government	07/07/2026 17:37:38	CR0726007000097813	140100	
ಸಂದಾಯದಾರನ ಹೆಸರು Remitter Name		Sree Vidyanikethana School	ಮೊಬೈಲ್ ಸಂಖ್ಯೆ Mobile Number	9886771824
ವಿಳಾಸ Address	No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036			
ಉದ್ದೇಶ Purpose	ಲೆಕ್ಕ ಶೀರ್ಷಿಕೆ Head of Account	ಉಪ ಉದ್ದೇಶದ ಹೆಸರು Sub Purpose Name	ಉದ್ದೇಶ ನಿರ್ದಿಷ್ಟ ಐಡಿ Purpose Specific ID	ಮೊತ್ತ Amount
COLLECTION OF FEES AND OTHER RECEIPTS FROM FIRE DEPARTMENT	0070~60~109~0~02~000	12.FOR ISSUE OF ADVISE ON FIRE PREVENTION AND FIRE FIGHTING FOR NON HIGH RISE BUILDINGS.	NA :	22000.00
ಸಂದಾಯ ಮಾಡುವ ಬ್ಯಾಂಕ್ Remittance Bank	State Bank of India e Pay	ಒಟ್ಟು ಮೊತ್ತ Grand Total	22000.00	
		ಒಟ್ಟು ಮೊತ್ತ ಅಕ್ಷರಗಳಲ್ಲಿ Total Amount in Words	Twenty Two Thousand Only	
ಪಾವತಿ ವಿವರಗಳು\Payment Details				
ಪಾವತಿ ವಿಧ Payment Mode		UPI		

*ನಿಮ್ಮ ವಹಿವಾಟನ್ನು ಸಂಸ್ಕರಿಸಲಾಗಿದೆ. ಮುಂದಿನ ಉಲ್ಲೇಖಕ್ಕಾಗಿ ದಯವಿಟ್ಟು ವಹಿವಾಟಿನ ಸಂಖ್ಯೆಯನ್ನು
ಬರೆದಿಟ್ಟುಕೊಳ್ಳಿ. ವಹಿವಾಟು ಸಂಖ್ಯೆ
Your Transaction has been processed. Please note the Transaction number for future reference. Transaction No.
8656041074733

*ಕ್ರೆಡಿಟ್ ಕಾರ್ಡ್/ಡೆಬಿಟ್ ಕಾರ್ಡ್ ಮೂಲಕ ಮಾಡಿರುವ ಎಲ್ಲಾ ಪಾವತಿಗಳ ಮೇಲೆ ಹೆಚ್ಚುವರಿ ಸೇವಾ ಶುಲ್ಕ
ಅನ್ವಯವಾಗುತ್ತದೆ. ಹಾಗೂ ಬ್ಯಾಂಕ್ ಅದನ್ನು ನೇರವಾಗಿ ಖರ್ಚು ಹಾಕುತ್ತದೆ.
Additional Service charges are applicable for all payments made through CC/DC and the same would be debited
directly by the bank.

*ಯಾವುದೇ ಸಂದರ್ಭದಲ್ಲಿ ಸಂದಾಯದಾರನು ಶುಲ್ಕ ಮರುಪಾವತಿಯನ್ನು ಕೊರಬಾರದು
Under no circumstances the remitter will seek a Charge Back



KARNATAKA STATE FIRE AND EMERGENCY SERVICES DEPARTMENT

Office of the District Fire Officer,
Banaswadi Fire Station, Banaswadi Main Road,
Kalyan Nagar Post, Bengaluru-560 043.
Ph. No. 080-22971540 / 22971611.



No. 17/SCHOOL/CC/DFO/BWFS/2026.

Date: 08-07-2026

'ANNEXURE - B'

Group- B Educational Building.

To,

The Chief Educational Officer,
M/s. Sree Vidyanikethana School,
(School U-DISE No. 29200310164)
No.18, 1st Cross, Sree Venkatagiriappa Layout,
R.R. Temple Road, Varanasi,
Bengaluru-560 036.

Sub: Issue of 'Fire Safety Compliance Report' with respect to fire prevention, fire fighting and evacuation measures maintained at 'M/s. Sree Vidyanikethana School', No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036.

Ref: 1. FSR report No.17/SCHOOL/FSR/DFO/BWFS/2026, Dated: 07-07-2026.
2. Your request letter, Dated: 07-07-2026.
3. Fire Station Officer, Banaswadi Fire Station, Inspection Report No.18/SCHOOL/CC/FSO/BWFS/2026, Dated: 08-07-2026.

With reference to subject above cited, 'fire safety recommendation' was issued wide reference (1) to the premises of M/s. **Sree Vidyanikethana School**, Comprising of Ground & 03 upper floors had height 13.07 mtrs. Situated at No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036 with a condition to fulfill the recommendations and compliance the same within 03 months.

With reference cited (2) above, the management of M/s. **Sree Vidyanikethana School** had requested for the fire safety compliance report from our department. In this regard the building was inspected by the Fire Station Officer, Banaswadi Fire Station on

SECRETARY
SREE VIDYANIKETHANA SCHOOL

No 18,1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036

Seena Joseph
PRINCIPAL

SREE VIDYANIKETHANA SCHOOL

No 18,1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036



08-07-2026 & submitted the inspected report cited in reference (3) above & recommended to issue of fire safety compliance report.

Under the above circumstances the Karnataka State Fire & Emergency Services Department is issue the **Fire Safety Compliance Report** to '**M/s. Sree Vidyanikethana School**', Comprising of Ground & 03 upper floors had height 13.07 mtrs. Situated at No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036. Subject to proper maintenance of fire fighting systems in good working conditions and to impart training for at-least 40% of staff/ employees should be trained in basic fire fighting at R.A. Mundkur Fire & Emergency Services Academy, Bannerghatta Road, Bengaluru at an earliest.

This fire safety compliance report is issued from the fire prevention and fire fighting point of view the Karnataka State Fire & Emergency Services Department is not responsible for the ownership of the land, its location and other disputes, which may arise in due course.

"In case the fire prevention and fire fighting measures installed in the building as per the recommendation of the department are not maintained in good working condition, if the evacuation measures are not properly followed and if any additional construction work is taken up in the building/premises, this fire safety compliance report deemed to be cancelled and necessary legal action will be initiated against the developer / management / tenant and also separate NOC has to be obtained from the department for the storage of Chemicals, Solvents, Petroleum products (Diesel/Petrol), LPG, etc in the premises/ building."

"This Fire Safety Compliance Report is issued for the period of only One Year from the date of issue and it is renewable without fail".

Yours faithfully,


8/7/2026
District Fire Officer
Karnataka State Fire and Emergency Services
Banasawadi Fire Station
Banasawadi, Bengaluru - 560043.

Copy to: Fire Station Officer, Banaswadi Fire Station.




SECRETARY
SREE VIDYANIKETHANA SCHOOL

No 18, 1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036


PRINCIPAL
SREE VIDYANIKETHANA SCHOOL
No 18, 1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036



KARNATAKA STATE FIRE AND EMERGENCY SERVICES DEPARTMENT

Office of the District Fire Officer,
Banasawadi Fire Station, Banasawadi Main Road,
Kalyan Nagar Post, Bengaluru-560 043.
Ph. No. 080-22971540/22971611.



No. 17/SCHOOL/FSR/DFO/BWFS/2026

Date: 07-07-2026

To,

**The Chief Educational Officer,
M/s. Sree Vidyanikethana School,
(School U-DISE No. 29200310164)
No.18, 1st Cross, Sree Venkatagiriappa Layout,
R.R. Temple Road, Varanasi,
Bengaluru-560 036.**

Sub : Issue of Fire Safety Recommendation to 'M/s. Sree Vidyanikethana School, Situated at No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036.

**Ref : 1) Your request letter, Dated: 29-06-2026.
2) Fire Station Officer, Banaswadi Fire Station, Inspection Report
No. 20/SCHOOL/FSR/FSO/BWFS/2026, Dated: 07-07-2026.**

With reference to the subject above cited, I wish to state that the educational building of **M/s. Sree Vidyanikethana School** Situated at No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036 was inspected by the Fire Station Officer, Banaswadi Fire Station on 01-07-2026 & submitted the inspected report cited in reference (2) above & recommended to issue of fire safety recommendation with respect to fire prevention, fire fighting and evacuation measures to be complied in the above premises. The details are as under:-

ANNEXURE-B

"B1 & B2- Schools upto senior secondary level and other institutions"

NBC-2016, Part-4, Table 7(11) 3.1.3 Group 'B' Educational Buildings

(These condition are indicative and not exclusive all relevant provisions related to fire and life safety of NBC 2016 & Government order No. HD/210/SFB/2025, Bengaluru, Dated: 12/01/2026 are mandatory)



**SECRETARY
SREE VIDYANIKETHANA SCHOOL**

No 18,1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036

PRINCIPAL

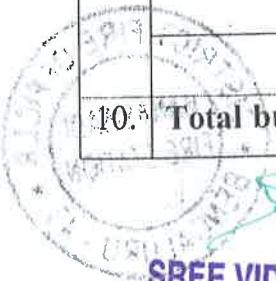
SREE VIDYANIKETHANA SCHOOL

No 18,1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036



A. Details of the building / Premises :-

1.	Name and address of the applicant.	:	The Chief Educational Officer, M/s. Sree Vidyanikethana School, No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036.
2.	Name and address of the premises.	:	<u>M/s. Sree Vidyanikethana School,</u> (School U-DISE No. 29200310164) No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036.
3.	Name and address of the building owner.	:	The Managing Trustee, M/s. Sree Venkatagiri Charitable Trust, No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036.
4.	Number of building.	:	One building
5.	Number of floors.	:	Ground & 03 upper floors.
6.	<u>Floor-wise details of occupancy:-</u>		
	Ground floor	:	04 Class rooms, 01 office room, 01 staff room, 01 computer lab & 01 store room.
	1 st Floor	:	07 Class rooms.
	2 nd Floor	:	06 Class rooms & 01 projector room.
	3 rd Floor	:	02 Class rooms, 01 library, 01 science lab & 01 computer lab.
7.	Height of the building.	:	13.07 Mtrs.
8.	Total site area.	:	4,089.21 Sq. mtrs.
9.	<u>Built-up area of each floor:-</u>		
	Ground floor	:	542.00 Sq. Mtrs.
	1 st Floor	:	542.00 Sq. Mtrs.
	2 nd Floor	:	542.00 Sq. Mtrs.
	3 rd Floor	:	542.00 Sq. Mtrs.
10.	Total built-up area.	:	2168.00 Sq. Mtrs.

**SECRETARY****SREE VIDYANIKETHANA SCHOOL**No 18, 1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036

PRINCIPAL
SREE VIDYANIKETHANA SCHOOLNo 18, 1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036

11.	Surrounding properties:-		
	East (Front)	:	Residential building.
	West (Rear)	:	06.50 mtrs. wide 2 st Cross road.
	North (Side)	:	06.50 mtrs. wide 1 st Cross road.
	South (Side)	:	Vacant land.
12.	<u>Set-back area available around the building :-</u>		
	East (Front)	:	Min. 12.00 mtrs.
	West (Rear)	:	0.90 Mtr.
	North (Side)	:	0.90 Mtr.
	South (Side)	:	07.20 Mtrs.

B. On inspection of this Educational building premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl.No. (1)	Details (02)	Existing (03)	Recommendations (04)
1.	Accessibility to the premises.	The premises is accessible from 06.50 mtrs. 1 st Cross road located on northern side & the road is hardened to carry the load of 45,000 kgs.	Adequate
2.	No. of entrance.	01 Entry cum exit have been provided.	
3.	Width of entry / exit.	05.50 mtrs. (Northern side).	
4.	Diesel generator.	One diesel generator of 15.00 KVA capacity has been provided to supply alternate power to all emergency provisions of the building.	Complied



SECRETARY
SREE VIDYANIKETHANA SCHOOL
No 18, 1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560033

Sreenivasulu
PRINCIPAL
SREE VIDYANIKETHANA SCHOOL
No 18, 1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036



5.	No. of staircases available.	Nos. of staircases	02 Nos.		Complied.
		Width of staircases	01.50 mtrs.	01.50 mtrs.	
		Width of treads	30 cms.	30 cms.	
		Height of risers	15 cms.	15 cms.	
		Nos. of riser per flight	08 nos.	08 nos.	
		Height of handrails	01.20 mtrs.	01.20 mtrs.	
6.	No. of lifts and capacity.	No. of lifts.	01 No.		
		Capacity of lifts.	04 Persons capacity.		
7.	Fire extinguishers.	25 Nos. of ABC type fire extinguishers each of 06 kgs. capacity, 01 no. of CO2 type fire extinguisher of 4.5 kgs capacity & 01 no. of mechanical foam fire extinguisher of 09 ltrs. capacity have been provided.			Complied.
8.	First aid Hose reel hose.	Provided 01 no. of hose reel hose system at staircase landing area and G.I pipe of min 63 mm size & hose reel hose of min 19 mm size of adequate length to reach farthest point of each floor with shut off branch having nozzle of 5mm size. The hose reel hose is connected at each landing by means of an adapter.			Complied.



SECRETARY

SREE VIDYANIKETHANA SCHOOL

No 18, 1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036

Seenaposeph
PRINCIPAL

SREE VIDYANIKETHANA SCHOOL

No 18, 1st Cross, Sree Venkatagiriappa Layout
R R Temple Road, Varanasi, Bangalore 560036



9.	RCC / FRP tank over respective tower terrace or Under ground static water storage tank.	Provided 5000 ltrs. capacity of water tank at terrace level exclusively for fire fighting purpose.	Complied.
10.	Pump near RCC / FRP tank over respective tower terrace / Under ground static water storage tank (Fire pump) with minimum pressure of 3.5 kg/cm ² .	The hose reel hose system has been connected to an booster pump capable of delivering 450 litres per minute discharge capacity.	Complied.
11.	Escape routes.	Escape route are marked with luminous paint at each floor directing towards exists and emergency exists.	Marked.
12.	Fire order. (Fire safety plans)	Fire safety indicating the details of action to be taken in case of emergency have been displayed near each staircase landings with the telephone numbers of Banaswadi fire station i.e. 080-22971540, fire control room i.e 101/ 080-22971500/550/600& telephone numbers of nearest ambulance service & police station.	Displayed.
13.	No smoking board.	COTPA Sec-4 direction "NO SMOKING"area-smoking here is an offence, board have been written in English & Kannada both language has been prominently displayed at inside the entry / exit of the each floor.	Displayed.



SECRETARY
SREE VIDYANIKETHANA SCHOOL
 No 18,1st Cross, Sree Venkatagiriappa Layout
 R R Temple Road, Varanasi, Bangalore 560036

Sreenivasulu
PRINCIPAL

SREE VIDYANIKETHANA SCHOOL
 No 18,1st Cross, Sree Venkatagiriappa Layout
 R R Temple Road, Varanasi, Bangalore 560036



13.	Nominate one fire nodal officer.	Not nominated.	A fire nodal officer shall be nominated either from teaching or non-teaching staff.
14.	Fire fighting training.	Not imparted.	At least 40% of staff should be trained in basic fire fighting course at our R.A.Mundkur Fire and Emergency Services Academy, Bannerughatta Road, Bangalore-29 at an earliest.
15.	<u>Fire precautionary measures :-</u> A) Explosive and flammable materials should not be stores in the store room, UPS room, Electrical panel area, class rooms, laboratory & electrical sum panel premises. B) Accumulation of combustible waste in and the premises should be avoided. C) The exit ways shall be always kept clear without any obstruction. D) Liquefied petroleum gas should not be stores in the building. E) The doors shall not be kept locked / latched during working hours and shall be free from obstruction. F) During the class hours the class room doors shall not be locked from inside to out side. G) As per Honorable Supreme Court order all teachers and staffs shall be trained to handle safety equipment, initiate emergency evacuation and protect their students in the event of fire and other emergency and the school shall observe the Fire Safety Day on April 14th of every year be conducting Fire Safety drills with co-ordinate Fire Service department.		



SECRETARY
SREE VIDYANIKETHANA SCHOOL
 No 18, 1st Cross, Sree Venkatagiriappa Layout
 R R Temple Road, Varanasi, Bangalore 560036

Sreedan Joseph
PRINCIPAL
SREE VIDYANIKETHANA SCHOOL
 No 18, 1st Cross, Sree Venkatagiriappa Layout
 R R Temple Road, Varanasi, Bangalore 560036



Under the above circumstance the Karnataka state Fire & Emergency Services Department is issuing of **Fire Safety Recommendation** to 'M/s. Sree Vidyanikethana School', Comprising of Ground & 03 upper floors had height 13.07 mtrs. Situated at No.18, 1st Cross, Sree Venkatagiriappa Layout, R.R. Temple Road, Varanasi, Bengaluru-560 036. Subject to condition and compliance of the above recommendations in column-4 of serial-B within 03 months and compliance to the undersigned.

This 'Fire Safety Recommendation' is issued for a period of only One Year from the date of issue and it is renewable.

Yours faithfully,


District Fire Officer
 Karnataka State Fire and Emergency Services
 Banasawadi Fire Station
 Banasawadi, Bengaluru - 560043.

Copy to: Fire Station Officer, Banaswadi Fire Station.


SECRETARY
SREE VIDYANIKETHANA SCHOOL
 No 18, 1st Cross, Sree Venkatagiriappa Layout
 R R Temple Road, Varanasi, Bangalore 560036


PRINCIPAL
SREE VIDYANIKETHANA SCHOOL
 No 18, 1st Cross, Sree Venkatagiriappa Layout
 R R Temple Road, Varanasi, Bangalore 560036